

4 1/2 DIGITAL PANEL METER

CSM-421

FEATURE

- Measuring DCA, DCV, ACA, ACV, Hz
- Accuracy: DC: $\pm 0.04\%$, AC: $\pm 0.1\%$
- 4 1/2 Digital display: 19999
- Easy-to-wire, screw type terminal
- Outside dimensions is 1/8 DIN standard (96x48mm)
- High stability & low cost

www.transducersandmeters.com




MEASUREMENT

Measuring Range	Resolution	Input Impedance	Variable to be Measured
Current	199.99 uA	0.01 uA	$\leq 1K$ ohm
	1.9999 mA	0.0001 mA	≤ 100 ohm
	19.999 mA	0.001 mA	≤ 10 ohm
	199.99 mA	0.01 mA	≤ 1 ohm
	1.9999 A	0.0001 A	≤ 0.05 ohm
	5.000 A	0.001 A	≤ 0.02 ohm
	10.000 A	0.001 A	≤ 0.01 ohm
Voltage	199.99 mV	0.01m V	$\geq 5M$ ohm
	1.9999 V	0.0001 V	$\geq 1M$ ohm
	19.999 V	0.001 V	$\geq 1M$ ohm
	199.99 V	0.01 V	$\geq 1M$ ohm
	300.0 V	0.1 V	$\geq 1M$ ohm
	600.0 V	0.1 V	$\geq 1M$ ohm
	Freq.	199.99 Hz	0.01 Hz
1999.9 Hz		0.1 Hz	$\geq 1M$ ohm

SPECIFICATION

- Measuring: DC: $\pm 0.04\%$ F.S. ± 1 digit
AC: $\pm 0.1\%$ F.S. ± 1 digit
Current: 20 Amax. Volt: 1000 Vmax.
- Span adjustment: $\leq 10\%$ of R.O.
- Zero adjustment: $\leq 2\%$ of R.O.
- Sampling time: About 3 cycles/sec.
- Polarity display: When input is negative "-"
- Over-range indication: "0000" flash
- Max. input over capability: Voltage: 1.2 x rated continuous
: 1.5 x rated for 10 seconds
Current: 10 x rated for 10 seconds
- Decimal point: Settable to any digit position
- Operation temperature: 0-60 °C
- Operation relative humidity: 20-95 %R.H.
- Temperature coefficient: ≤ 100 PPM/°C (0-50°C)
 ≤ 50 PPM/°C (23 \pm 3°C)
- Storage temperature: -10-70°C
- Power Supply: AC: 115/230V $\pm 10\%$, 50/60 Hz
Option: DC 12 V, 24V, 48V $\pm 10\%$ (Isolated)
DC: 3W, AC: 4.5 VA
- Power consumption: DC: 3W, AC: 4.5 VA
- Dielectric Strength: AC 2.0 KV for 1 min. (Between Power / Input)
AC 3.0 KV for 1 min. (Between Terminal / Case)
- Weight: About 370g

ADJUSTMENT

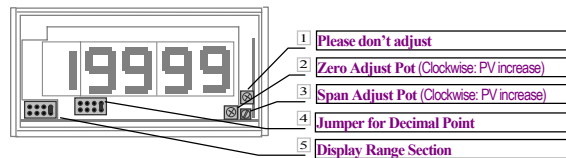

5 Display Range Section:


Section	Jumper	Display Range	Section	Jumper	Display Range
1	---	19999-17000	5	---	9000~ 6250
2	---	17250-13000	6	---	6250~ 4250
3	---	13000~ 9000	7	---	4250~ 3000
4	---	12000~ 8250	8	---	3000~ 2000

4 Decimal Point Jumper:




The meter is calibrated at the factory per order. If your meter will need to be re-calibrated "Only" by qualified Technician.

DIMENSIONS

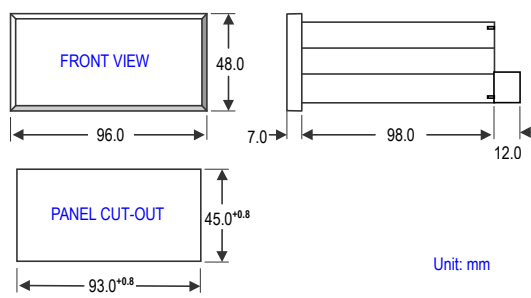

CONNECTION DIAGRAM

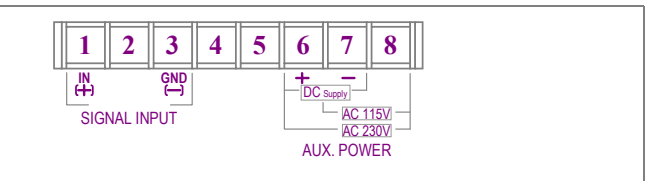

ORDER INFORMATION

CSM-421 Input Type — Input Range — Aux. Power

CODE	INPUT TYPE	CODE	INPUT RANGE	CODE	INPUT RANGE	CODE	INPUT RANGE	CODE	AUX. POWER
D	DC	A	199.99 uA	1	199.99mV	1	199.99 Hz	A	AC 115/230 V
A	AC	B	1.9999 mA	2	1.9999 V	2	1999.9 Hz	D12	DC 12 V
TR	TRMS	C	19.999 mA	3	19.999 V	O	Specify	D24	DC 24 V
F	Frequency	D	199.99 mA	4	199.99 V	1	AC 2-200 V	D48	DC 48 V
		E	1.9999 A	5	300.0 V	2	AC 30-600 V	O	Specify
		F	5.000 A	6	600.0 V	3	Pulse 5 V		
		G	10.000A	V	Specify (V i/p)	4	Pulse 12 V		
		I	Specify (A i/p)			5	Pulse 24 V		
						O	Specify		